

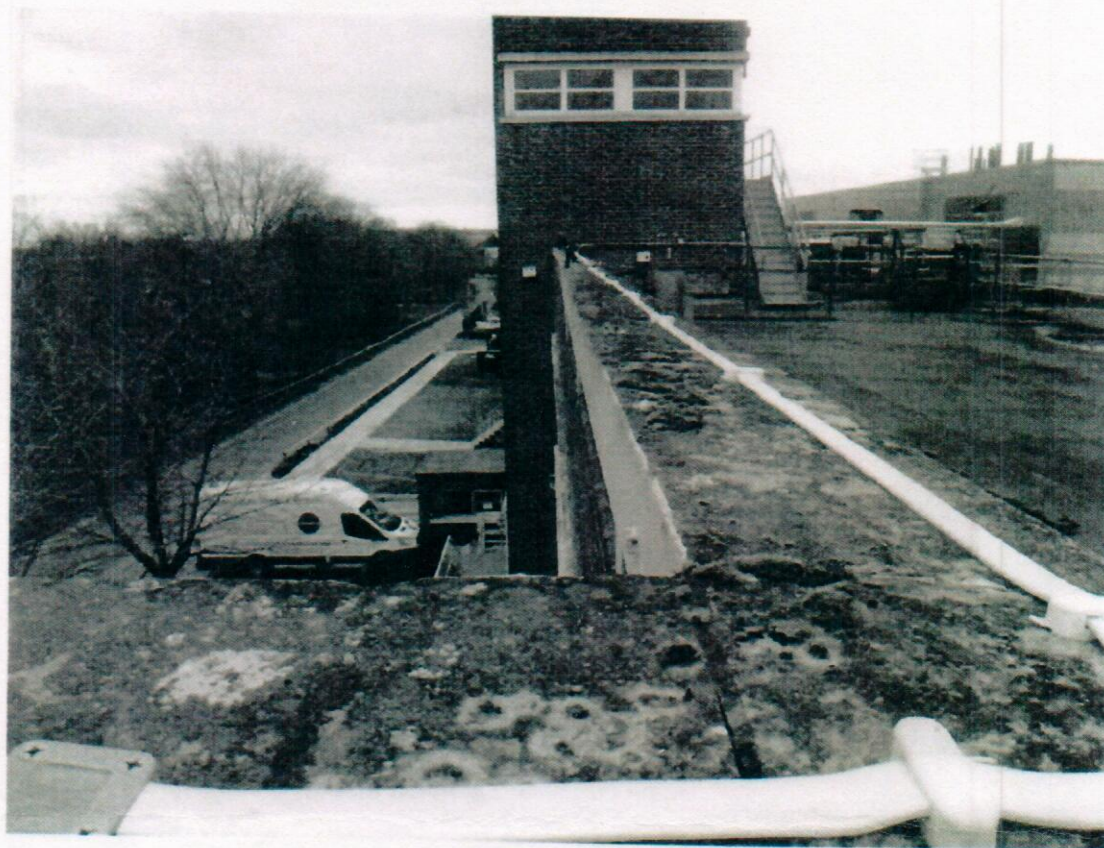


Figure 5 - View along top of parapet wall with worst case deformation

The construction of the parapet wall as 215mm thick solid brickwork and a close up showing the deterioration of the mortar can be seen in Figure 6 and Figure 7 whereby at least 50% of the mortar is spalled.

Regular brickwork movement joints were noted around the parapet wall however there was some evidence of minor in plane movement causing the ends of the walls at internal corners to no longer be flush.