



Key

- Existing random flintwork to arched panels between buttresses: localised/isolated defective mortar pointing and individual loose/detached and/or dropped flints. Rake out and repoint defective mortar pointing to flintwork. Remove loose/detached individual flints. Reinstall removed/dropped flints in former positions bedded and pointed in lime mortar.
- Rake and repoint defective/open mortar joints to stonework to buttress. Point with lime mortar

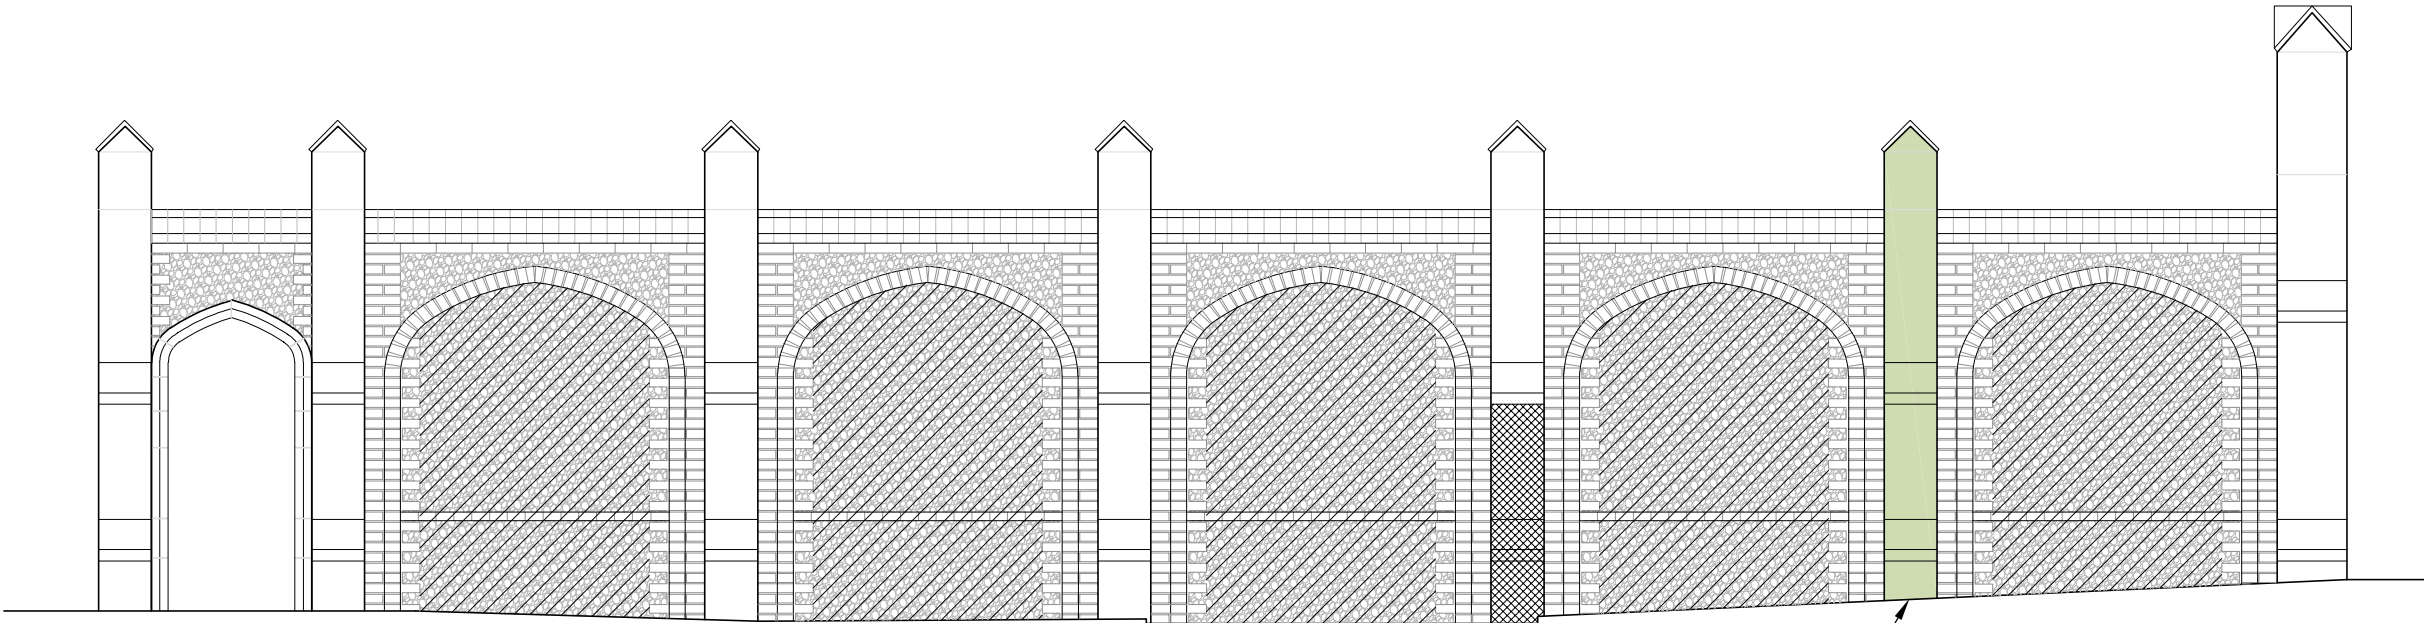

01 SOUTH ELEVATION: Repairs
1:50

 Damaged buttress: vehicle impact damage has displaced individual stones, including the lower plinth and offset: Allow for dismantling the whole of the buttress 100% and rebuilding to match existing on a 'like for like' basis. Existing salvaged stones to be bedded and pointed in lime mortar in their former positions



revision/date note

 **morseWEBB**
architects

The Byre The Street Bramley Hampshire RG26 5DE

T: 01256 587888 W: www.morsewebb.co.uk

project		
Caversham Court		
title		
North Boundary Wall Buttress as Proposed		
scale	status	
1:50@A3	PLANNING	
job no.	dwg no.	status/revision
1053	151	PL00

© Morse Webb Ltd