

Level and Crack Monitoring

Our Ref: 531994

Date of Issue: 01/05/2020

Provider Details

CET Property Services - 0116 2605309

Monitoring Details

Instruction Date:	17/08/2018		
Number of visits	6	Visit Frequency (Wks)	8

Visit Dates (future dates are estimated)

Setup	1	2	3	4	5	6
03/09/18	29/10/18	24/12/18	18/02/19	15/04/19	10/06/19	05/08/19

Client Details

Insurance Co.:	
Client Ref:	
Client Name:	
Technical Mgr:	David Cliffe
Customer support	
Tel:	
Email:	

Risk Address


Occupier:	Removed for data protection purposes
Address:	71 Milman Road
Address:	
Town:	Reading
County:	
Post Code:	RG2 0AZ
Contact Name	Removed for data protection purposes

Level and Crack Monitoring - Site Sketch

Our Ref: 531994

Date of Issue: 01/05/2020

TBM HILT
NAIL YELLOW
SPRAY IN

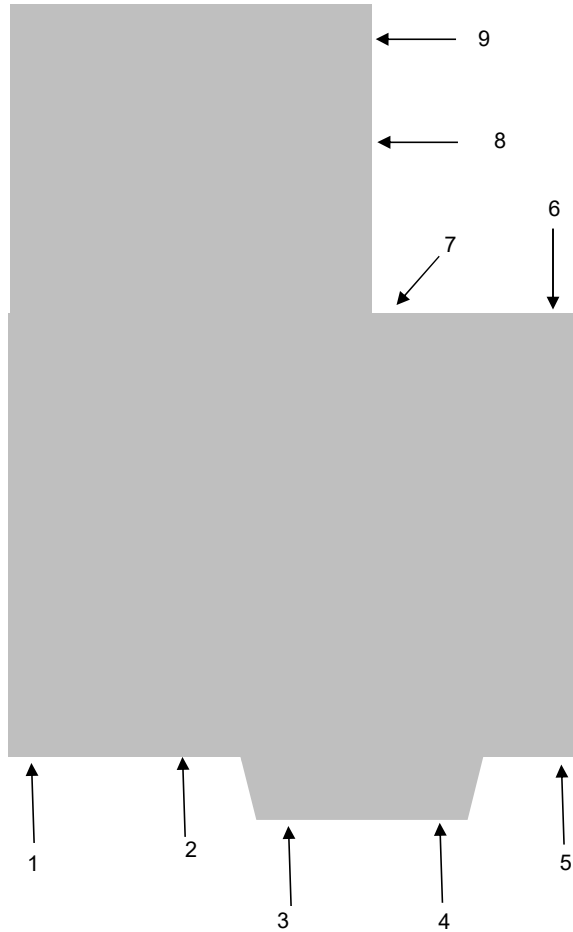

FRONT

Level Monitoring - Reduced Levels (in metres)

Our Ref:

531994

Date of Issue:

01/05/20

Reading Date	3/9/18	11/12/18	4/3/19	10/5/19	11/7/19	27/9/19	20/11/19	20/1/20	30/4/20			
Point / Reading	1	2	3	4	5	6	7	8	9	10	11	12
1	9.9866	9.9873	9.9880	9.9892	9.9891	9.9870	9.9864	9.9949	9.9892			
2	9.9768	9.9780	9.9799	9.9811	9.9808	9.9769	9.9782	9.9822	9.9815			
3	10.4748	10.4765	10.4787	10.4805	10.4797	10.4742	10.4764	10.4818	10.4811			
4	10.4558	10.4577	10.4619	10.4637	10.4625	10.4550	10.4587	10.4652	10.4650			
5	10.6161	10.6189	10.6234	10.6251	10.6236	10.6149	10.6194	10.6267	10.6275			
6	9.4848	9.4889	9.4913	9.4946	9.4899	9.4826	9.4890	9.4981				
7	9.5822	9.5850	9.5863	9.5878	9.5857	9.5815	9.5836	9.5897				
8	9.4820	9.4836	9.4841	9.4859	9.4837	9.4818	9.4821	9.4901				
9	9.3798	9.3839	9.3841	9.3860	9.3838	9.3805	9.3800	9.3866				
not used												
not used												
not used												
not used												
not used												
not used												
not used												
Tech Initials	NM	NM	MT	MT	MT	RN	MK	IT	NM			
Level S/N.	521947	521947	522222	521947	521948	701612	702396	103446	523149			

Level Monitoring - Movement (in millimetres)

Our Ref:


531994

Date of Issue

01/05/20

[illegible]

Level Monitoring - Movement relative to datum against Date

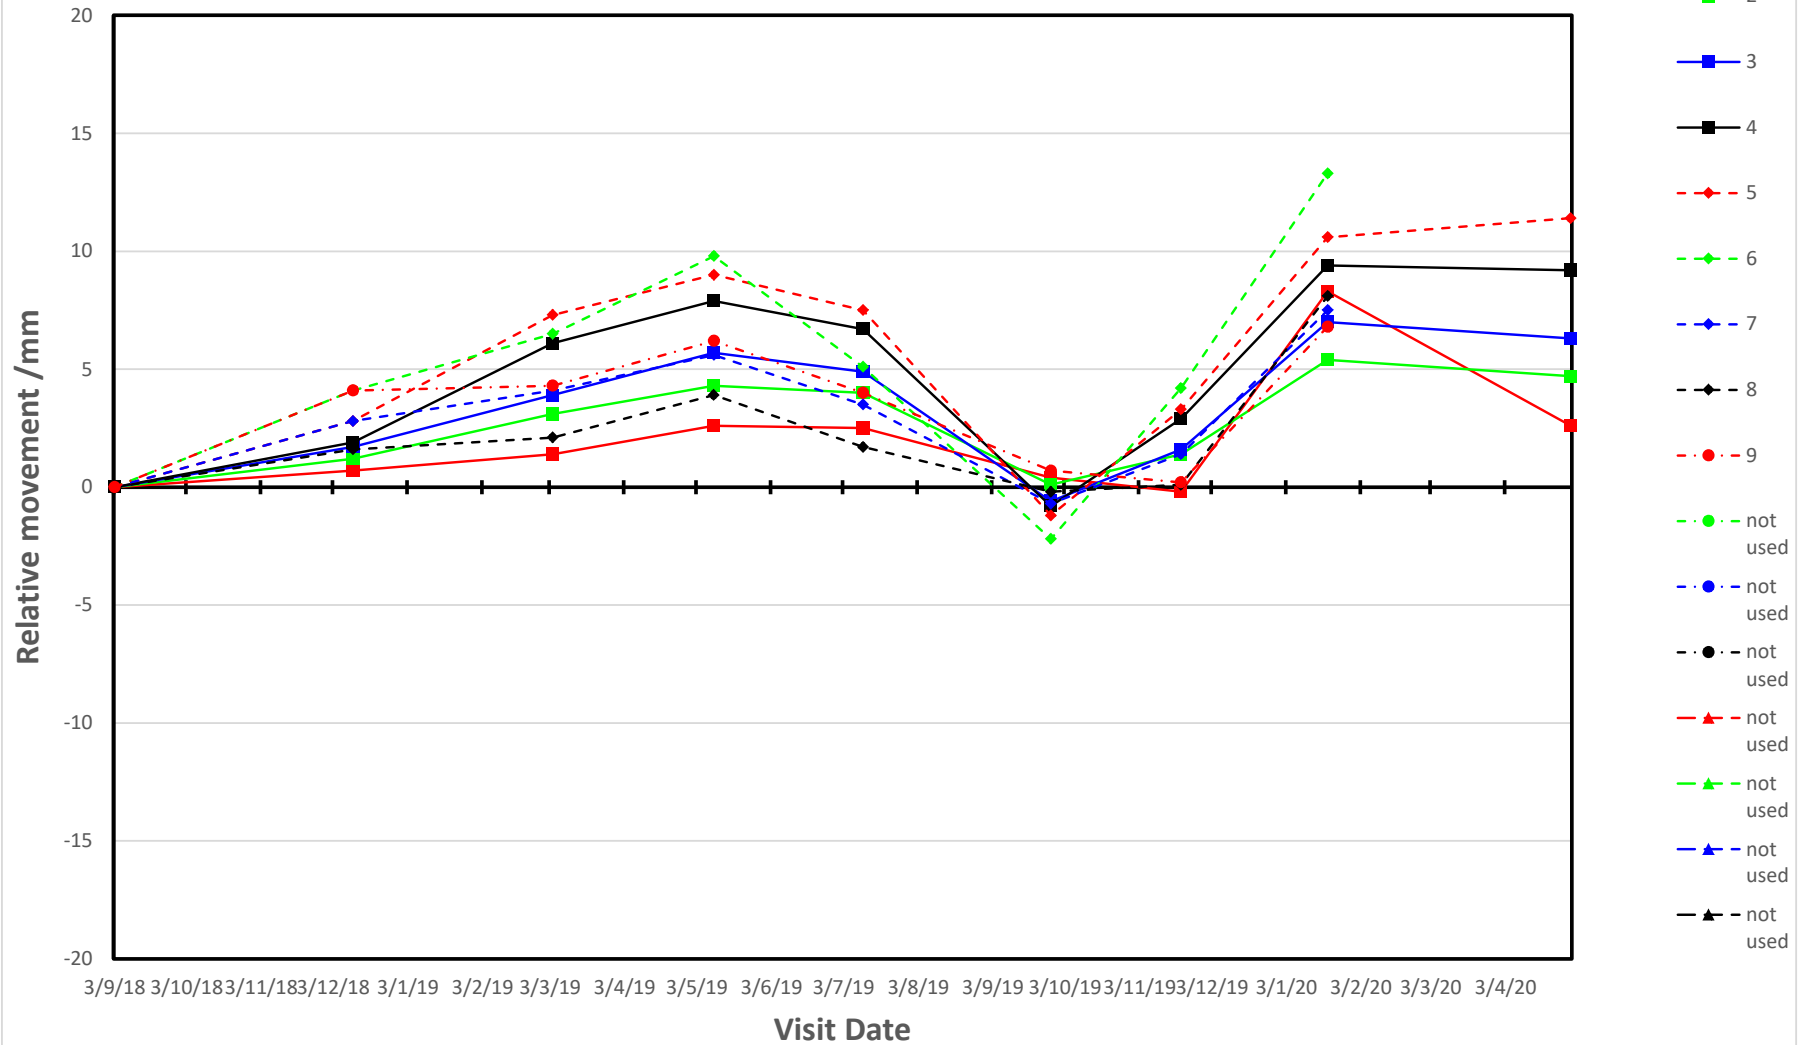



Our ref	Client ref	Client Name	Issue Date
531994	6846356	Sedgwick	01/05/2020

Stud locations

1	EXT Middle Above Front Door
2	EXT Above Front Door Left Hand side
3	EXT Front Bay Window DPC Level
4	EXT rear right corner down corner from window
5	
6	

Additional instructions / notes

Crack Monitoring - Readings

Studs nos.	Align-ment	Visit Date	20/11/19	Visit Date	20/01/20	Visit Date	30/04/20	Visit Date		Visit Date		Visit Date	
		Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w
1	H	62.13		59.26	2.50	59.19	2.70						
1	D												
1	Check												
2	H	59.34		59.04	23.68	59.56							
2	D												
2	Check												
3	H	36.66		36.27	6.56	36.31	6.63						
3	D	71.22		70.73		70.83							
3	Check	60.33		60.15		60.56							
4	H	51.56		51.44	1.02								
4	D												
4	Check												
5	H												
5	D												
5	Check												
6	H												
6	D												
6	Check												
Calliper nos :		8669		55002		2860							
Technician :		MK		IT		NM							

Our ref	Client ref	Client Name	Issue Date
531994	6846356	Sedgwick	01/05/2020

Crack Monitoring - Movement Against Time

