

GENERAL NOTES: EXISTING

Flooring

Basement: Brick floor, with partial over tiling within defunct WCs.
Ground floor: Presumed screed, covered with modern carpet.
First, Second and Third floor: Timber softwood floor boards (140 x 26mm) on softwood joists, with heavy stapling and partial underlay cover.

Walls

Generally rendered lime plaster on lath to timber-stud or rendered direct to masonry, with applied joinery and decorative plasterwork. Local areas of plaster failure evident, presumed related to water ingress. Areas of missing plaster, exposing brickwork. Areas of missing skirtings, architrave, dado, picture rails and cornices.

Ceilings

Basement: Brick vaulted or concrete ceilings.
Ground, First and Second floor: Generally lime lath and plaster, directly secured to joists. Local areas of loss, presumed related to water ingress. Some local cracking and bowing, indicative of detachment from substrate.
Third floor: All ceilings removed.

Doors and windows

Generally timber sash windows, with large pane glazing. Most in need of repairs, with anticipated sill decay and failed mechanisms.
Leaded quarry glazing to staircase, set within terracotta surrounds.
Generally timber paneled doors, some over-boarded.
Ironmongery incomplete, but generally historic and in need of renovation.

Finishes and linings

Most surfaces painted or wallpapered (none appears historic). Evidence of paint incompatibility in several locations.

Roof

Slate on battens, supported on rafters and purlins. Larger king-post trusses spanning accomodation area. Extensive distribution of repairs, including lead and slate replacement.

Miscellaneous

Numerous marbled slate fireplaces and cast iron inserts, presumed original.
Part incomplete bird protection installed to exterior.

Services

Generally defunct and surface run. Most appear to date from the mid-20thC, and are considered of no significant importance.

Drawings based on survey by others. Roof drawn indicatively - no survey information available.

LEGEND

- Limit of demise
- Area outside of demise/ application scope
- Timber Boards
- Brick Floor
- Linoleum/ Ceramic Tiles
- Carpet
- Area of lost ceiling / cornice
- Area of lost plaster / linings

Modern wall vent indicating blocked up fire opening.

Mid-late 20thC partition and doors.

Mid 20thC opening through partition.

Lead-lined open trough gutter, supported on timber framing.

All ceilings removed, exposing ceiling joists above throughout floor. Consequentially, at high-level wall plaster generally damaged or missing.

Modern wall vent indicating blocked up fire opening.

Mid-late 20thC partition and doors.

Floor adhesive applied to landing boards.

Panelled door, covered with modern board.

Modern board installed over fire opening (insert presumed to remain).


01: existing third floor plan 1:50

Rev	Date	Dwn	Chkd	Description	Rev	Date	Dwn	Chkd	Description
	05.07.18	FM	JC	Draft Planning Issue for comment					
A	09.07.18	FM	RG	LBC/ PLANNING ISSUE					

6 King Street Bristol BS1 4EQ
T 0117 929 9293 E info@fm-architects.co.uk
F 0117 929 9295 W fm-architects.co.uk

- All drawings are copyright
- Report all discrepancies to project administrator
- Do not scale drawing for construction purposes
- All dimensions to be checked on site

0 2.5m

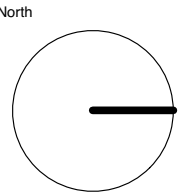

LBC/ PLANNING ISSUE

PRINT IN COLOUR ONLY

ferguson mann architects

Job Title 149-150 Friar Street, Reading					Drawing Title Third Floor Plan		
Client One Reading LLP c/c TCN UK					Existing Plans		
Scale	1:50@A1 1:100@A3	Date	05.07.18	Dwn	FM	Chkd	JC
Job No		10768		Drawing No		PL 0014	
Rev		A					