


Rev.	Date	Note	Author	Checked
A	26/04/23	Revised following RBC comments	IG	CTW

EXISTING BASEMENT B-12
EXISTING ARCHED ENTRANCE DOOR D-B-01

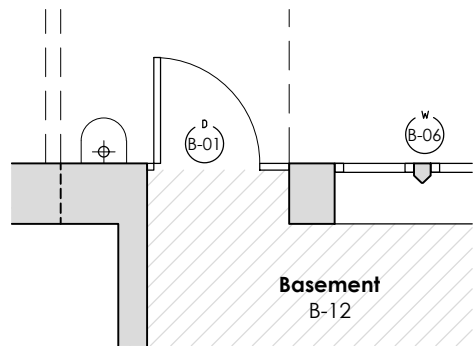

GENERAL ARRANGEMENT PLAN 1/50

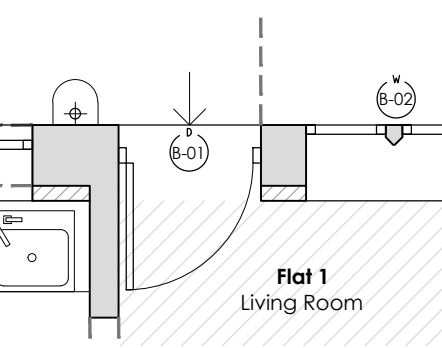


Figure 01

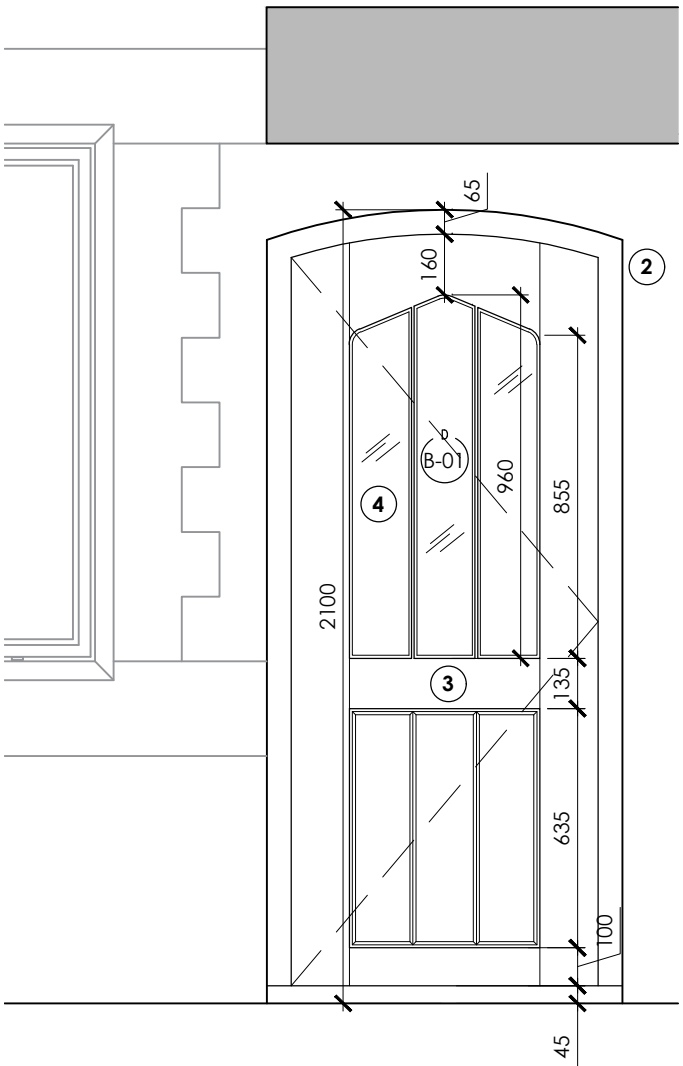


Figure 02


PROPOSED FLAT 1
PROPOSED NEW ENTRANCE DOOR D-B-01




GENERAL ARRANGEMENT PLAN 1/50




EXTERNAL ELEVATION 1/20

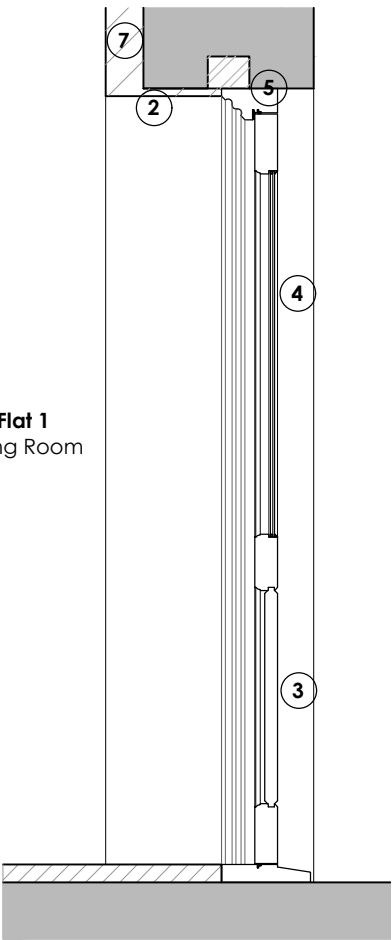


SECTION 1/20

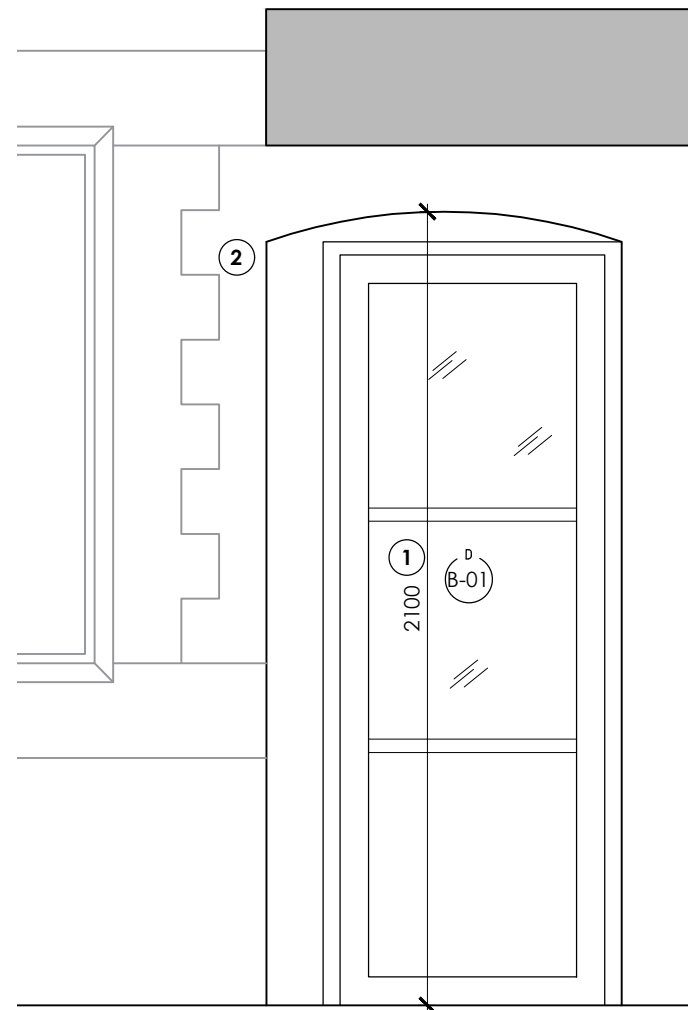


EXTERNAL ELEVATION 1/20

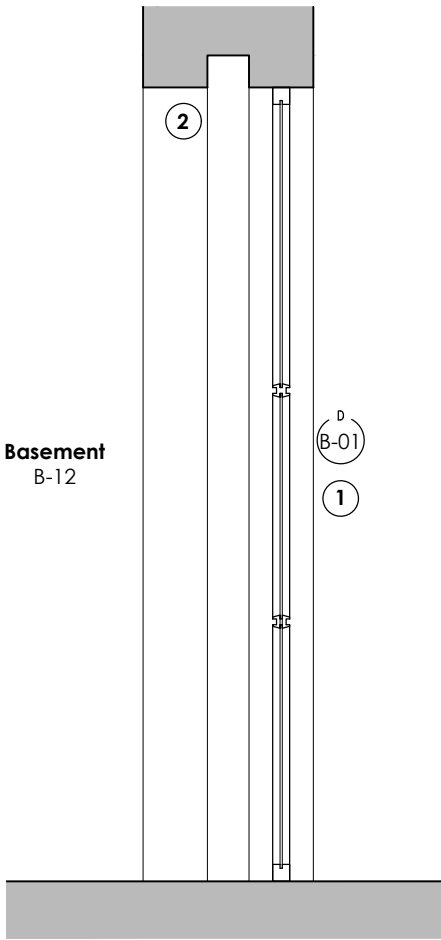


SECTION 1/20

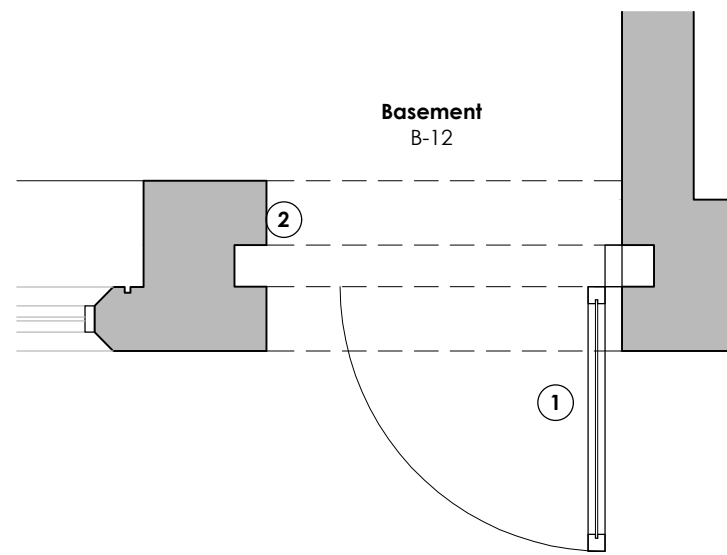

PLAN 1/20

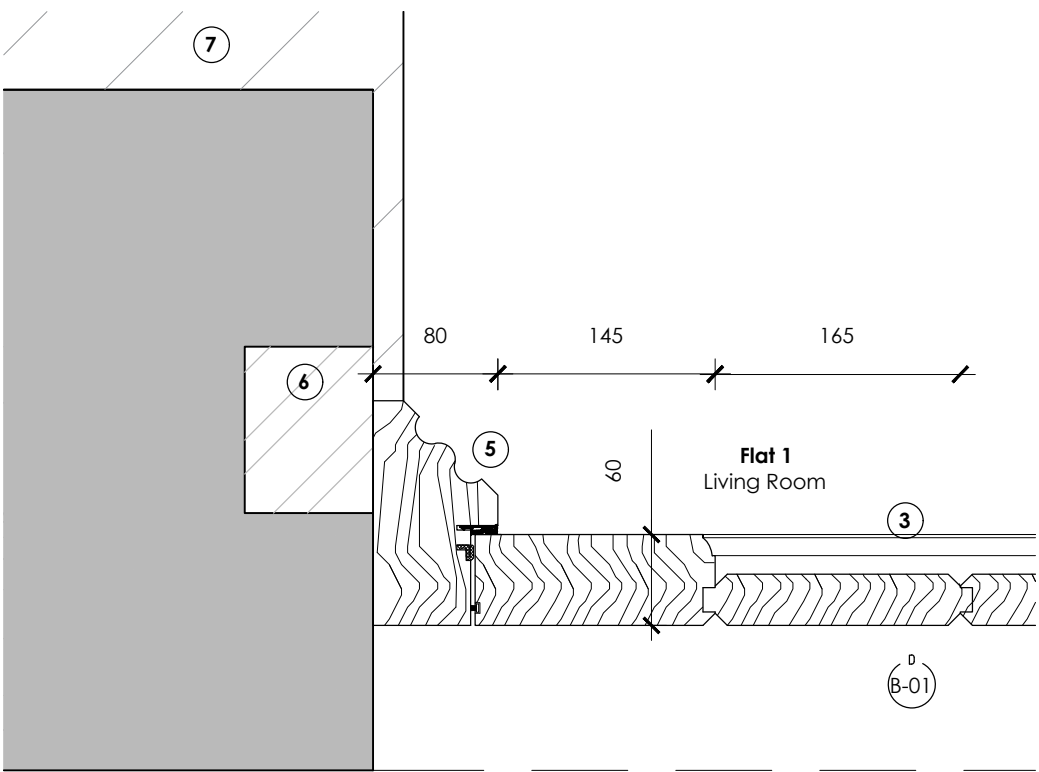

DOOR JAMB DETAIL - PANEL 1/5

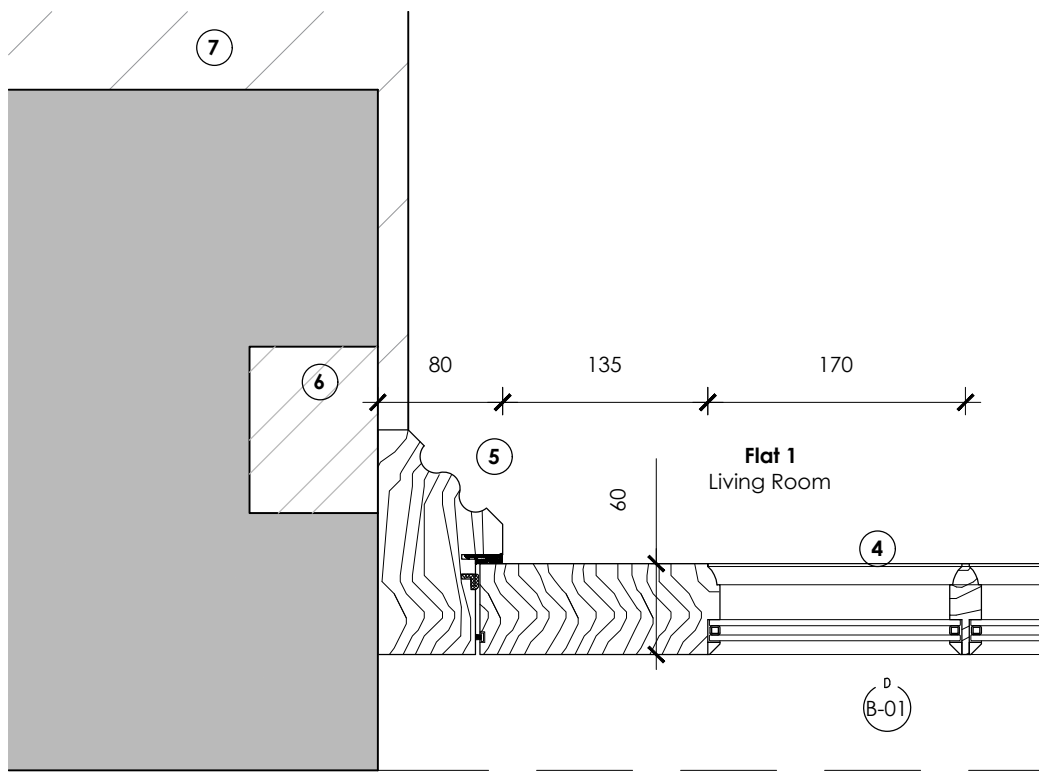

DOOR JAMB DETAIL - GLAZING 1/5

MATERIAL KEY

- ① Dilapidated timber door not large enough for opening
- ② Brick arch headed opening
- ③ Painted timber half-glazed panel door with chamfered closeboarding detail, colour: off white
- ④ Glazed upper door panel with glazing bars
- ⑤ Painted timber door frame with moulding to match existing
- ⑥ Existing gap in-filled with brickwork to match existing
- ⑦ Proposed damp proofing & insulating dry-lining system

1:50
0 1 2 3 4 5m

Project	Refurbishment & Alterations Carlisle House, 118 Oxford Road Reading RG1 7NG				Drawing	Existing & Proposed Entrance Doors (1) D-B-01					
					Job-Dwg Number	18009-PL-44		Rev.	A		
Client	Turner Property Ltd				WESTON + CO ARCHITECTS Watlington House 44 Watlington Street Reading, RG1 4RJ T. 0118 375 0252 www.weston-co.com						
Status	Planning										
Scale	1/5, 1/20 & 1/50		Sheet Size							A2	
Author	IG	Checked	CTW	Date						17/04/2023	