


Rev.	Date	Note	Author	Checked
-	dd/mm/yy	Note	XXX	XXX


(To be removed & stone recycled into repairs elsewhere on the building)

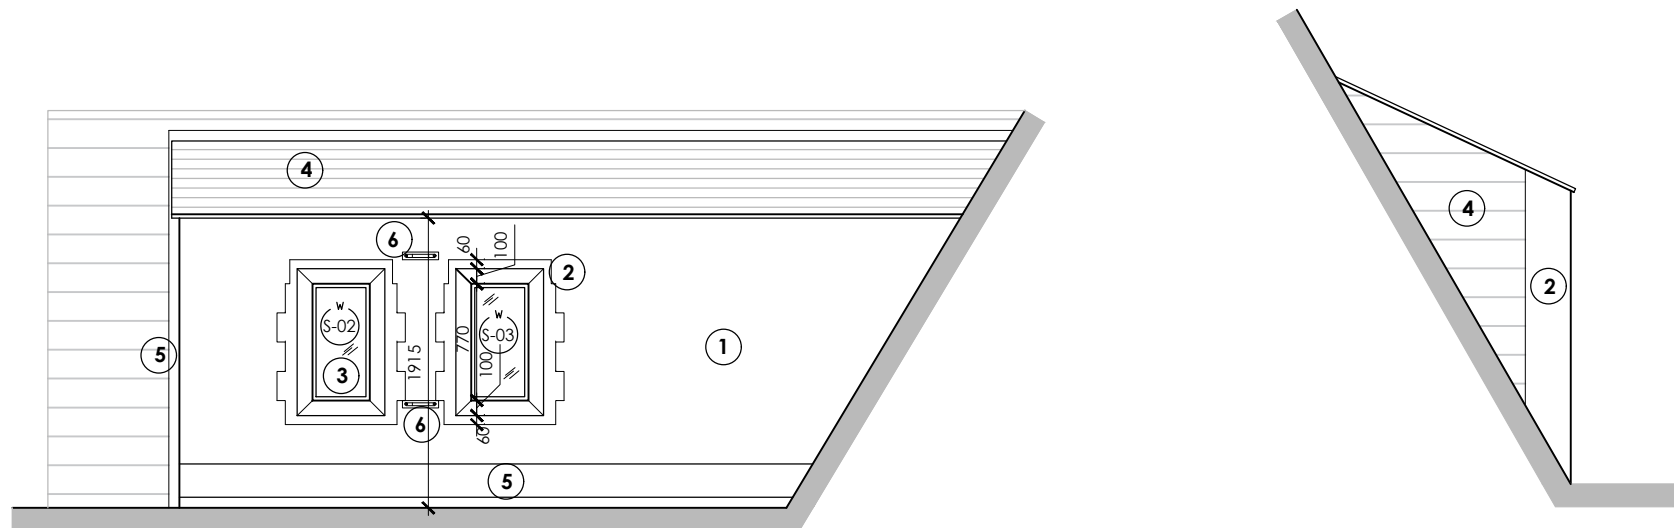


ELEVATION **A** 1/50



Figure 01

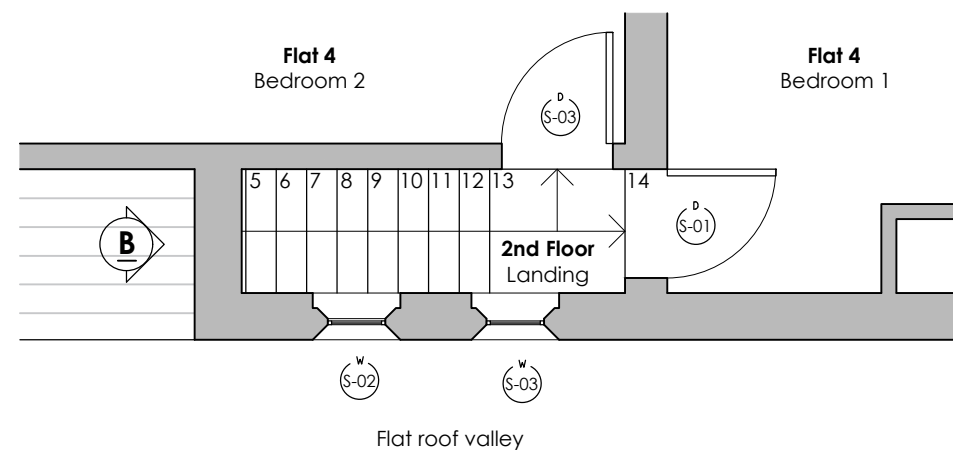


PLAN 1/50

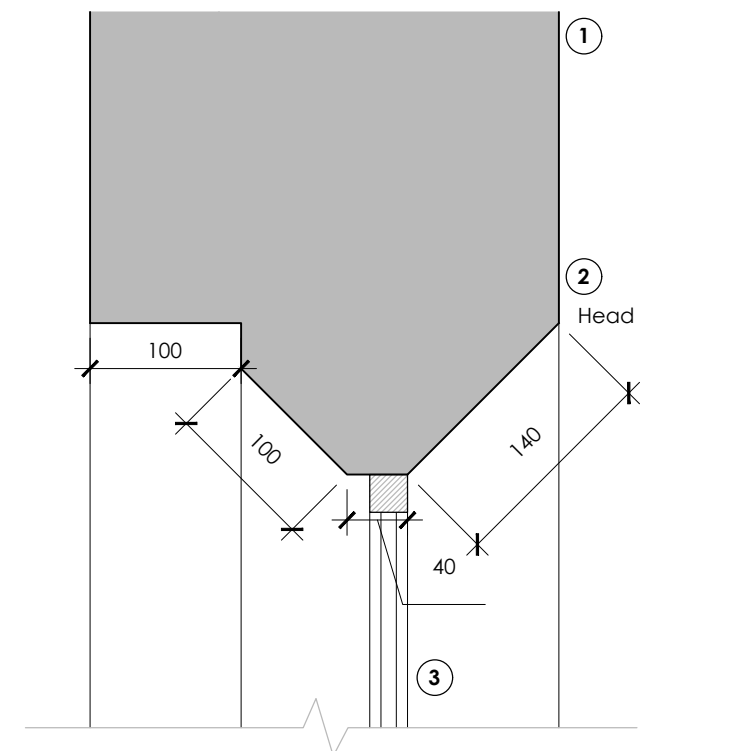

Interior:
2nd Floor
Landing

Exterior:
Flat roof valley

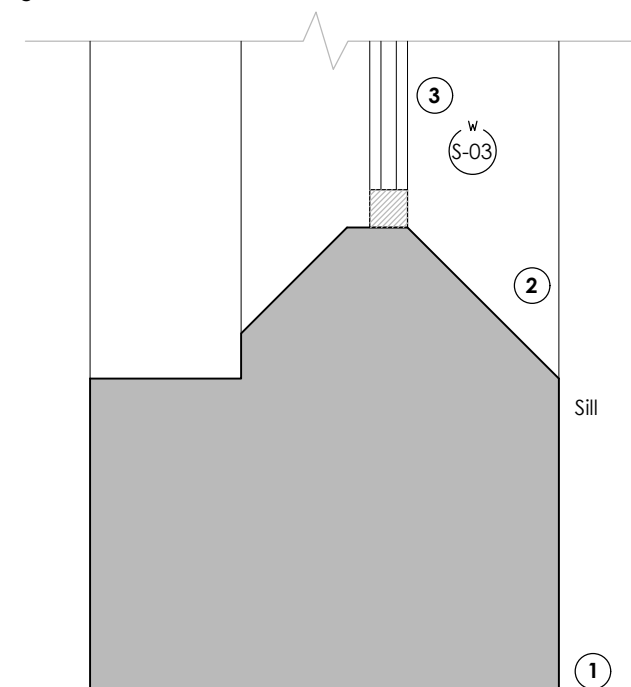

SECTION 1/5




Figure 02



Figure 03

- ① Coarse stonework wall finish
- ② Dressed stone played window surround & corner quoining
- ③ Slim metal framed single glazed windows
- ④ Roof and dormer cheeks with natural slate tile finish
- ⑤ Lead flashing to flat roof abutment
- ⑥ Cast iron rainwater pipe straps

1:50

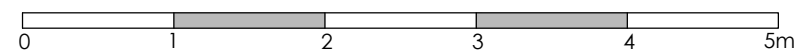

Project	Refurbishment & Alterations Carlisle House Reading RG1 7NG					Drawing	Drawing & Photographic Recording: Existing Second Floor Dormer Volume			
						Job-Dwg Number	18009-PL-37	Rev.	-	
Client	Turner Property Ltd					WESTON + CO ARCHITECTS Wallingford House 44 Wallington Street Reading, RG1 4RJ T. 0118 375 0252 www.weston-co.com				
Status	Planning									
Scale	1/5 & 1/50		Sheet Size A3							
Author	IG	Checked	CTW	Date	17/04/2023					