


Rev.	Date	Note	Author	Checked
-	dd/mm/yy	Note	XXX	XXX

EXISTING BASEMENT B-05
EXISTING WINDOW W-B-02 & W-B-03

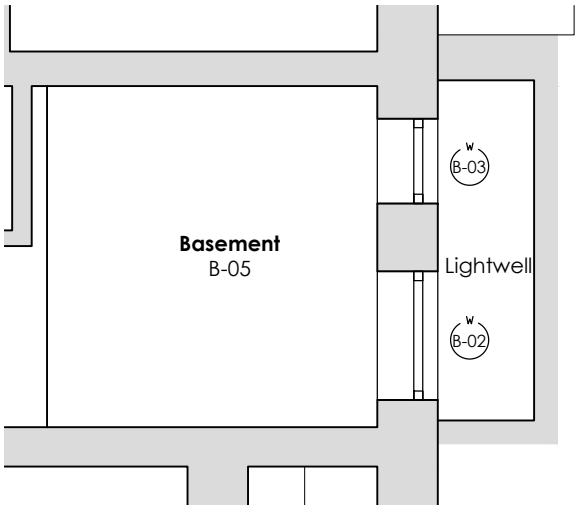

GENERAL ARRANGEMENT PLAN 1/50



Figure 01


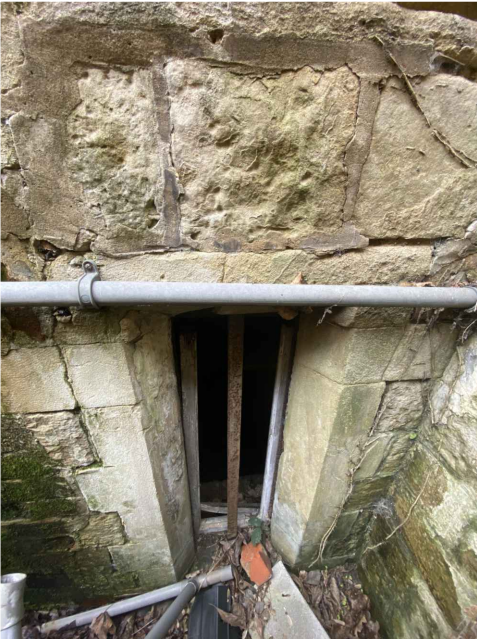


Figure 02



PROPOSED FLAT 1 BEDROOM 2
PROPOSED NEW WINDOW W-B-05

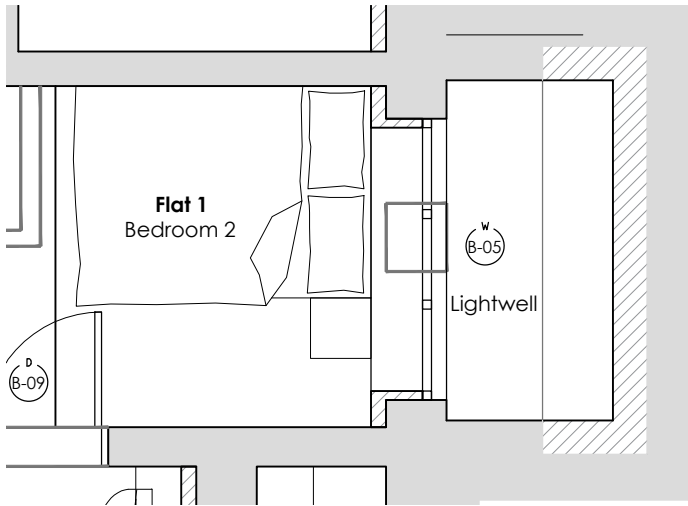


GENERAL ARRANGEMENT PLAN 1/50

MATERIAL KEY


- 1 Coarse stonework wall finish
- 2 Dressed stone splayed window surround
- 3 Dilapidated slim metal framed window
- 4 Dilapidated window opening
- 5 Proposed new slim-framed PPC aluminium heritage frame profile window, colour: dark grey
- 6 Dressed stone window surround extended to match existing
- 7 Proposed new white glazed brickwork to lightwell
- 8 Proposed damp proofing & insulating dry-lining system

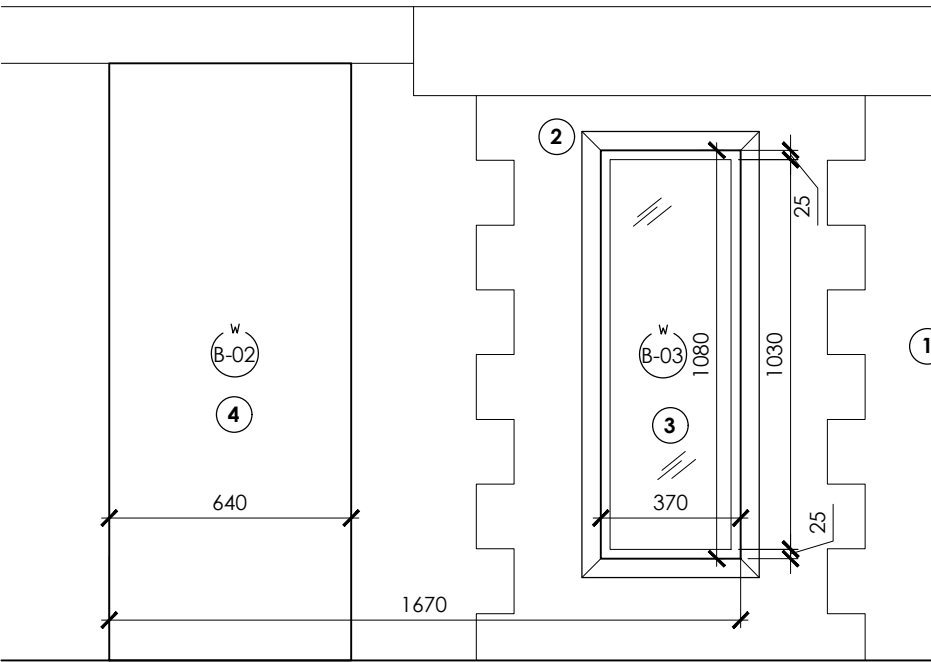


EXTERNAL ELEVATION 1/20

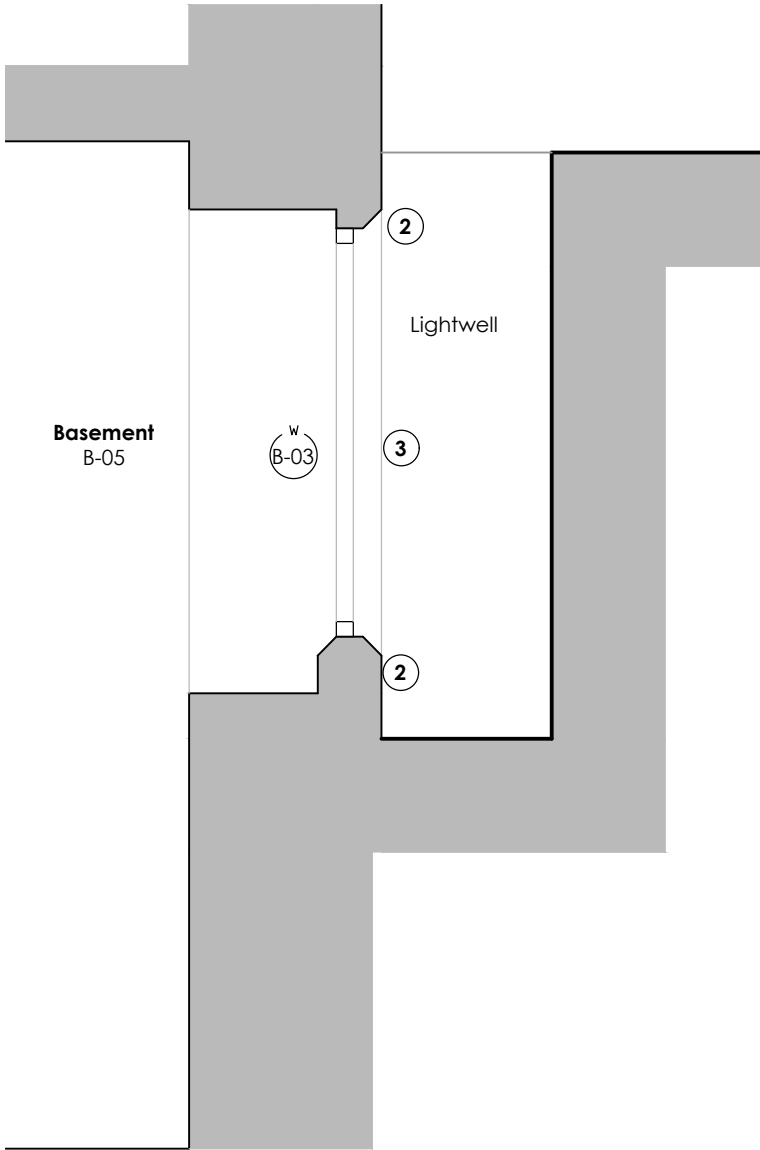


SECTION 1/20

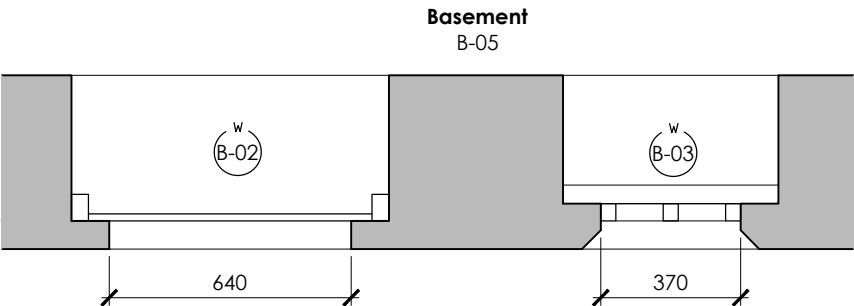


PLAN 1/20

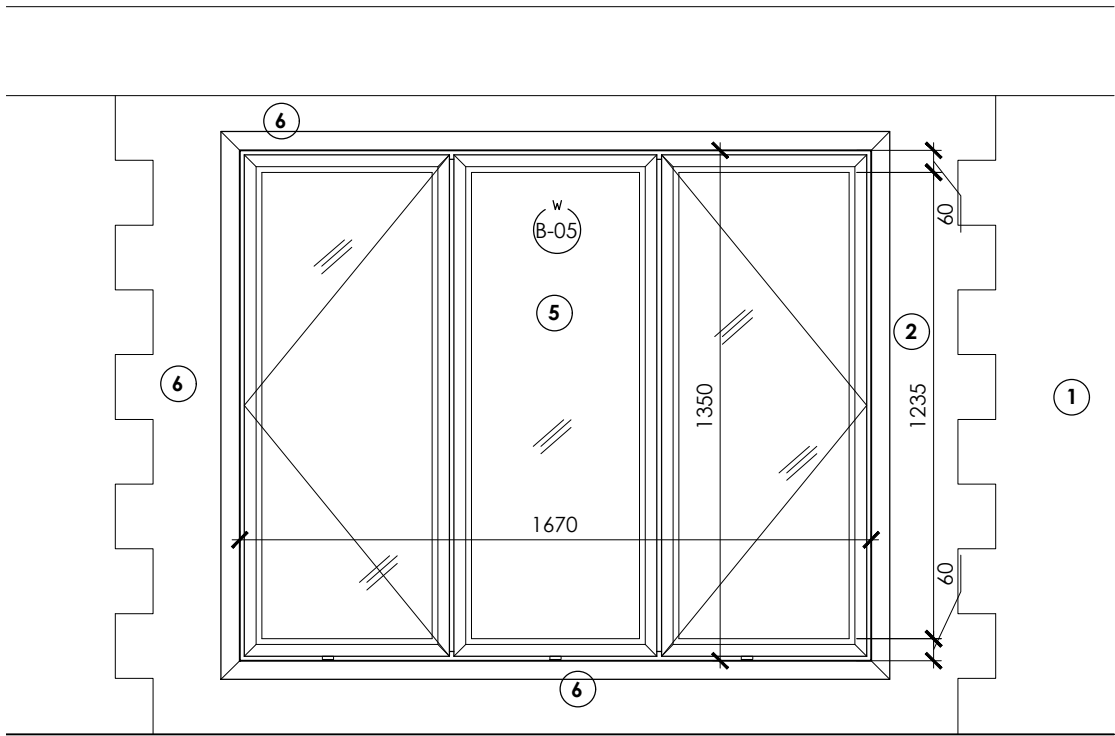

EXTERNAL ELEVATION 1/20

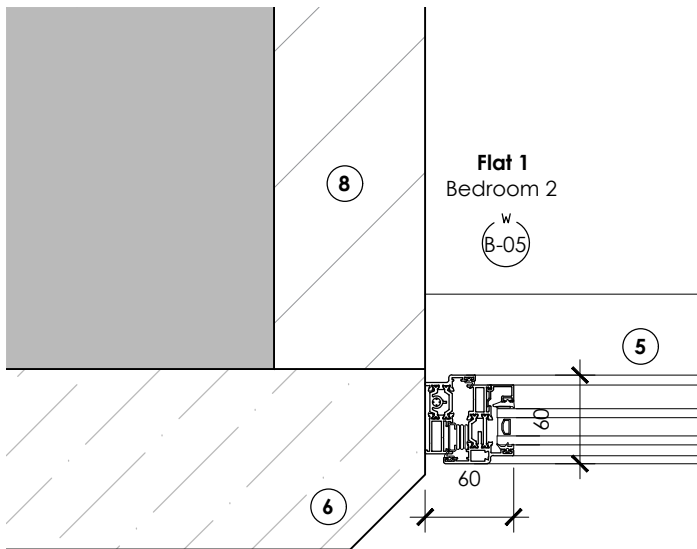

WINDOW JAMB DETAIL 1/5

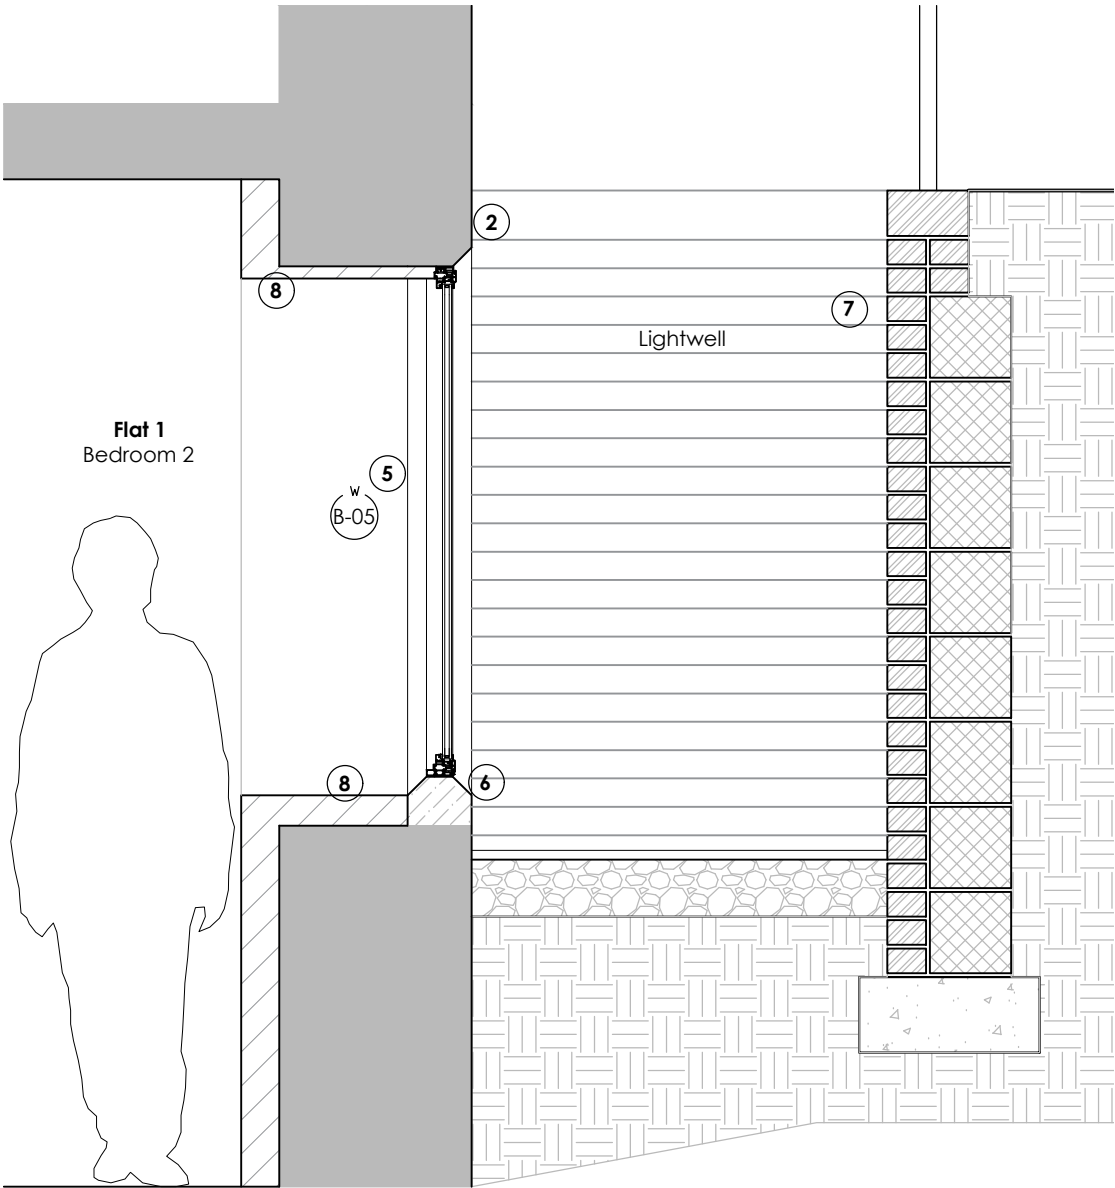

SECTION 1/20

Project	Refurbishment & Alterations Carlisle House, 118 Oxford Road Reading RG1 7NG					Drawing	Existing & Proposed Windows (2) W-B-05			
						Job-Dwg Number	18009-PL-39		Rev.	-
Client	Turner Property Ltd					WESTON + CO ARCHITECTS Watlington House 44 Watlington Street Reading, RG1 4RJ T. 0118 375 0252 www.weston-co.com				
Status	Planning									
Scale	1/5, 1/20 & 1/50		Sheet Size A2							
Author	IG	Checked	CTW	Date	17/04/2023					