

Site Investigation Report

Auger Ref:

113774.1.TSI



Job Information

Client	Sedgwick
Client ref	9075732
Visit date	23/11/2020
Report date	23/11/2020

Job Summary

✓ 2 trial holes undertaken. [Read more.](#)



Job Information

Overview

Brief

Auger were commissioned by Sedgwick to undertake a site investigation within the area of concern at the property.

Photographs

Trial Hole 1

Fig 1.1: Trial Hole 1 Location



Fig 1.2: Trial Hole 1 Footing



Trial Hole 2

Fig 2.1: Trial Hole 2 Location



Fig 2.2: Trial Hole 2 Footing

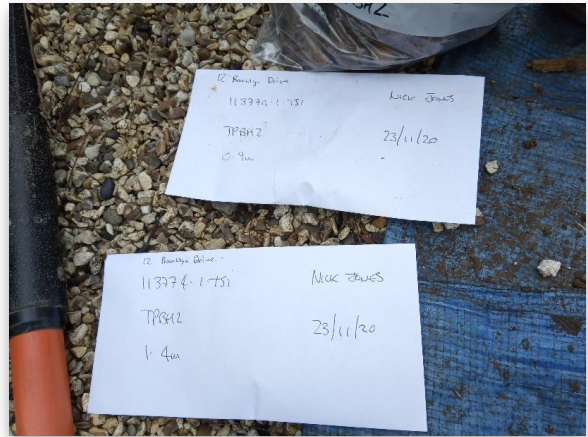


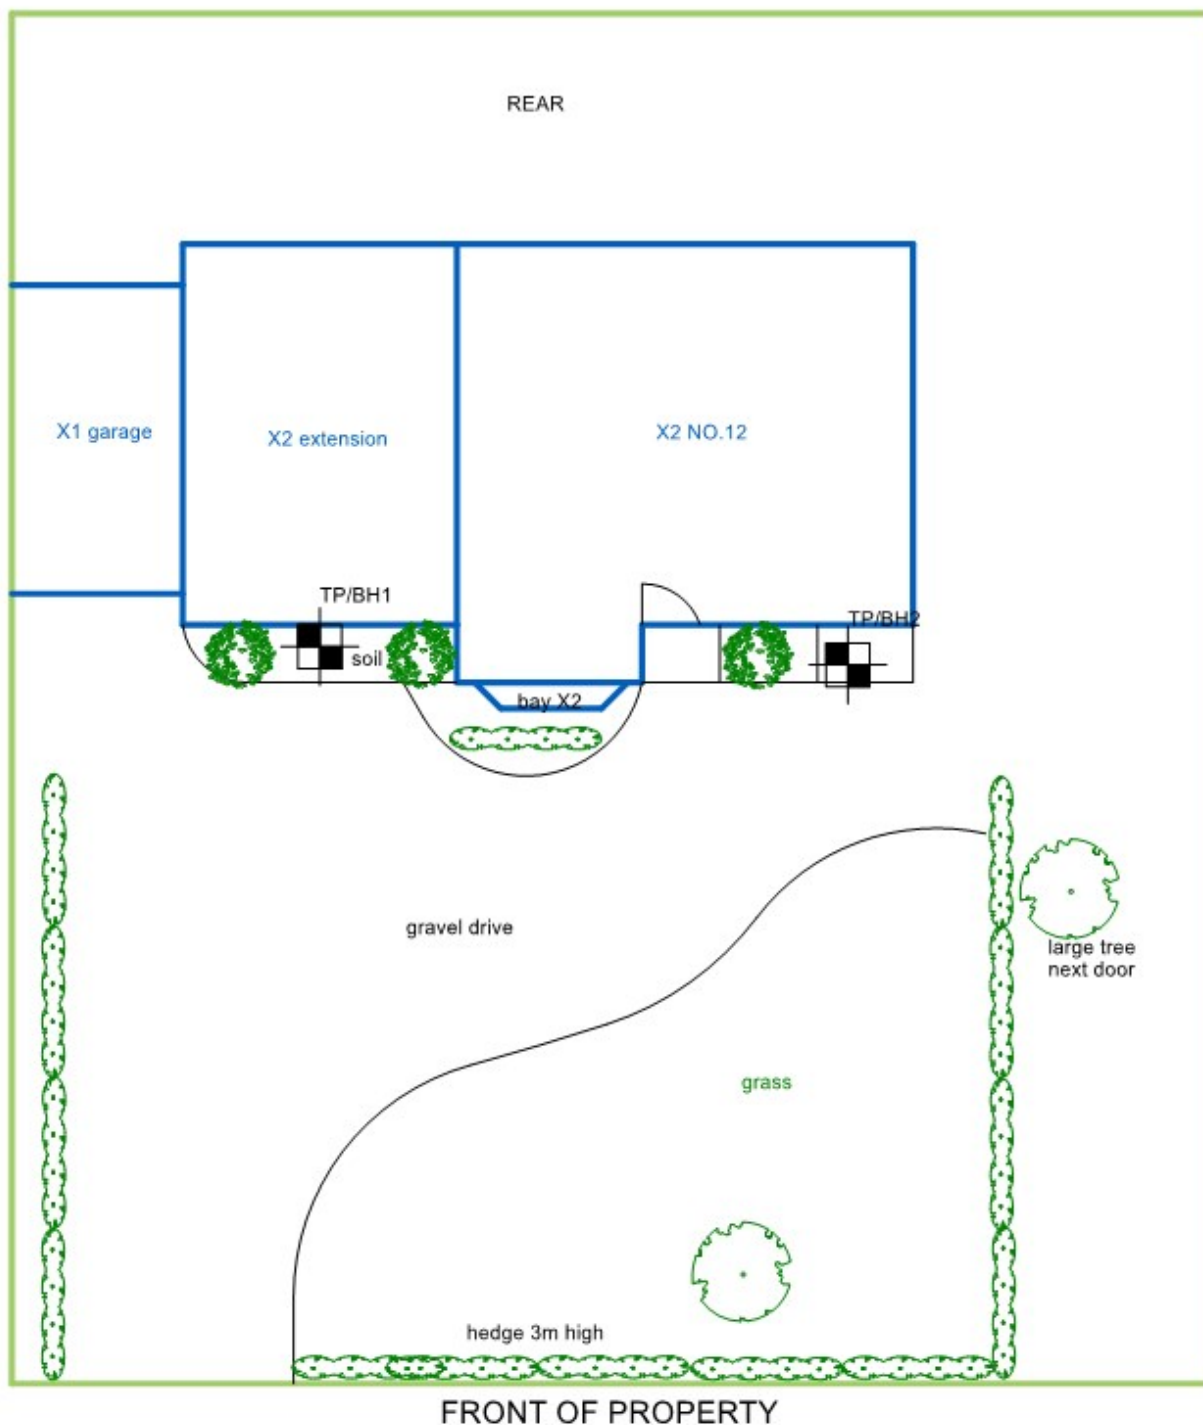
Other Photos

Fig 3.1: Soil samples collected



Fig 3.2: Root samples collected





This drawing should be used for diagrammatic purposes only. Auger are not responsible or liable for any 3rd party works undertaken using the details outlined in this drawing. Confirmation of the drainage configuration can only be confirmed by excavation or detailed technical survey.

LEGEND

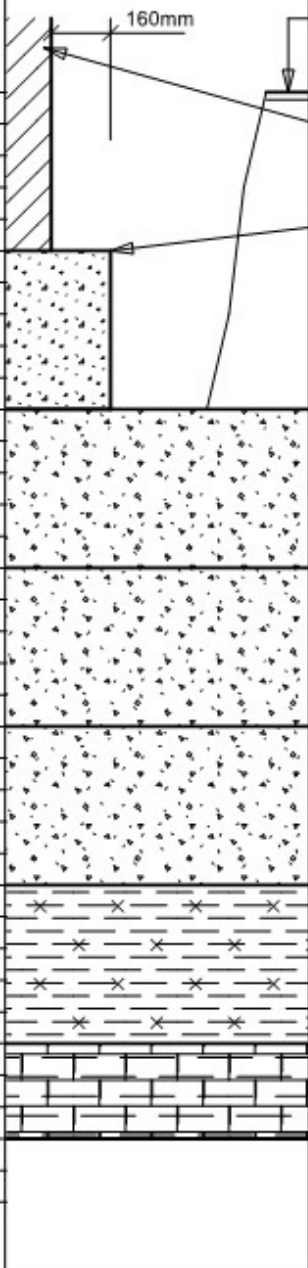
	= Manhole		= Blockage		= Lines not camera surveyed		= Steps		= Trial hole		= Shrubs/bush
	= Inspection Chamber		= syp/w/c		= Lines camera surveyed		= Borehole		= Hedge		= Tree
	= Inspection Pot		= wg/fwg		= Assumed water mains feed		= Direction of flow				
			= rwg		= Walls						
			= rwp		= Fences						
					= Building Outline		= gate / door				



Trial Hole Log No.1

Location: Front left x2 ext

Job Ref:
113774.1.TSI

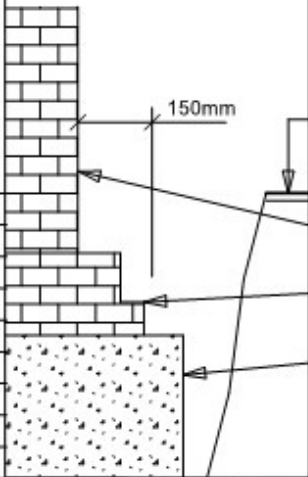
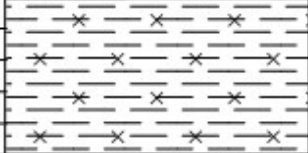
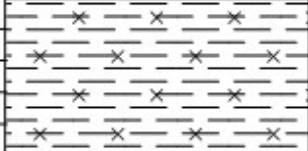
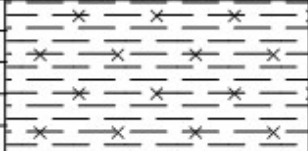
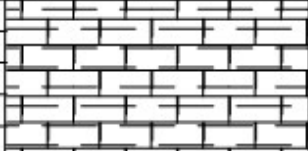
Depth (m)	Symbolic Log	Strata Description	Insitu Tests		Soil Sample	Root Sample
			SV(19)	MP (300mm)		
0.0		Ground Level				
		Soil (Border)				
		Blockwork				
		Concrete				
0.5						
1.0		Dry medium dense Brown sandy GRAVEL		90blows	Soil @ 1m	Root @ 1m
1.5		Brown fine gravelly sandy silty CLAY		66blows	Soil @ 1.5m	
2.0		Brown sandy GRAVEL		150blows	Soil @ 2m	
2.5		Dry very stiff Brown fine gravelly silty CLAY	100kpa		Soil @ 2.5m	
3.0		Dry very stiff Brown off white fine to medium chalky silty CLAY	120kpa		Soil @ 3m	
3.5		TRIAL HOLE TERMINATED	120kpa			



Trial Hole Log No.2

Location: Front right x2 main house

Job Ref:
113774.1.TSI

Depth (m)	Symbolic Log	Strata Description	Insitu Tests		Soil Sample	Root Sample
			SV(19)			
0.0		Ground Level Soil (Border) Brickwork Double Step Concrete				
0.5						
1.0		Dry very stiff Brown fine to medium gravelly silty CLAY	120kpa		Soil @ 0.9m	Root @ 0.9m
1.5		Brown silty CLAY	128kpa		Soil @ 1.4m	Root @ 1.4m
2.0		Dry very stiff Brown fine to medium gravelly silty CLAY	126kpa		Soil @ 1.9m	
2.5		Dry very stiff Off white brown CHALK	120kpa		Soil @ 2.4m	
3.0		Off white clayey CHALK	120kpa		Soil @ 2.9m	
3.5		TRIAL HOLE TERMINATED	120kpa			