

LEVEL MONITORING

for Subsidence Management Services

81 Baker Street, Reading, RG1 7XY

Client:	Subsidence Management Services
Client Contact:	Cyril Nazareth
Claim Number:	9075232
Client Reference:	IFS-AVI-SUB-19-0084937
Policy Holder:	Reading Spiritualist Church
Report Date:	23 June 2020
Our Ref:	M15099


Level Monitoring Readings

The following table shows the reading levels of the various Level Monitoring Station points.

Date	1	2	3	4	5	6
07/01/2020	10.0000	9.9709	9.7912	10.2080	10.0000	10.3159
28/02/2020	10.0000	9.9706	9.7913	10.2060	9.9996	10.3155
24/04/2020	10.0000	9.9713	9.7919	10.2062	10.0006	10.3162
17/06/2020	10.0000	9.9707	9.7912	10.2052	9.9994	10.3148



Level Monitoring Difference Graphs

The following graphs display the progressive movement that each Level Monitoring Station recorded at each separate site visit date to give an overall look at how much the property is moving.

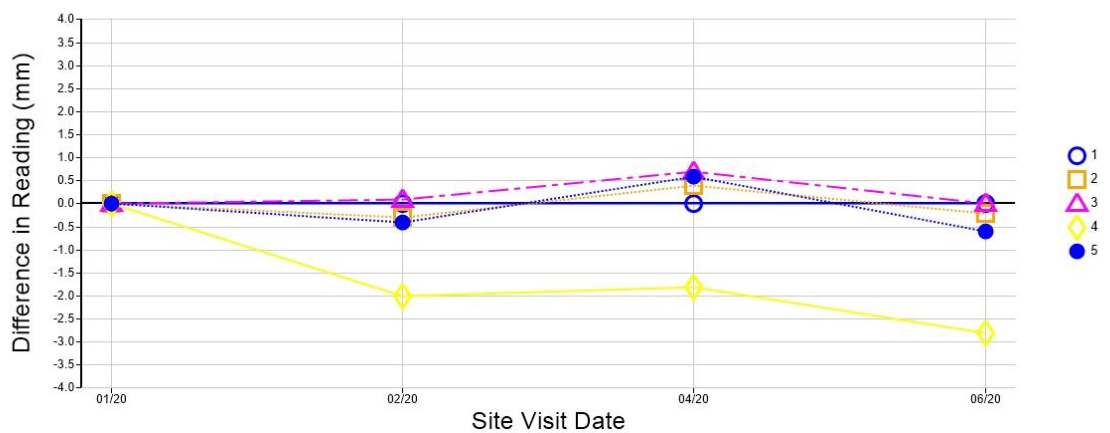

Level Monitoring Displacement Map

The following image shows an isometric representation of the movement of the property, based on the Level Monitoring Stations that were installed.

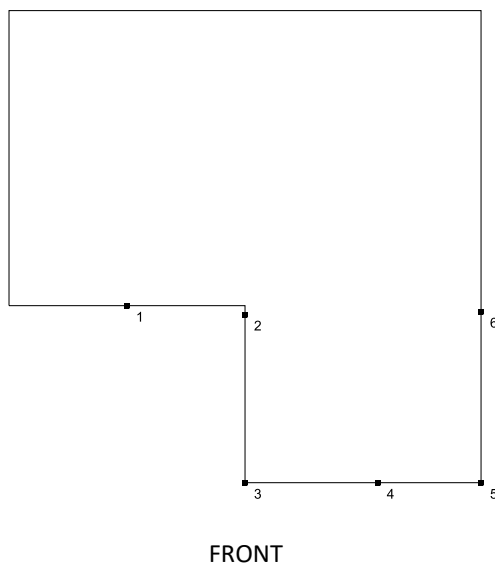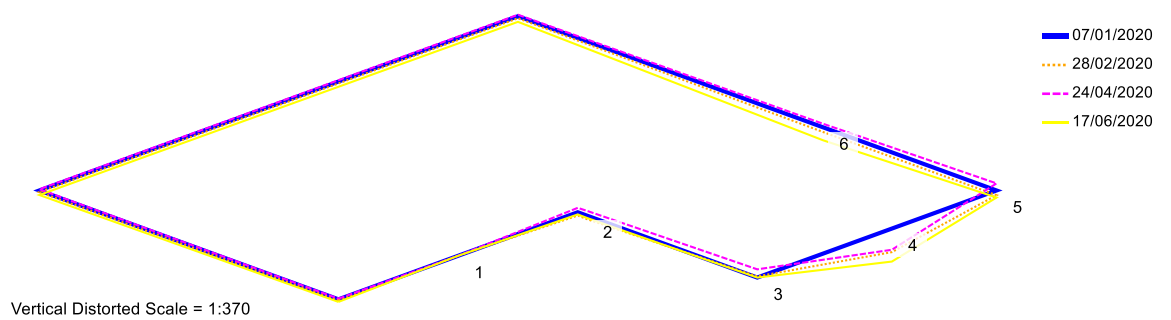

Site Visit Notes

Datum is level station 1 as requested, it has an assumed value of 10.0000m. No suitable remote datum so no secondary TBM available. If this is not suitable please advise if a deep datum is required.

Site Visit: 7 January 2020

Relative survey.

Site Visit: 28 February 2020

Point 4 close to trees, not loose.