

LEVEL MONITORING

for Subsidence Management Services

2 Russet Glade, Emmer Green, Reading, Berkshire, RG4 8UJ

Client:	Subsidence Management Services
Client Contact:	Peter Moore
Claim Number:	0662167188
Client Reference:	IFS-CIS-SUB-18-0078398
Policy Holder:	Mr Syed Imad-Ud-Din
Report Date:	18 June 2020
Our Ref:	M13414



Level Monitoring Readings

The following table shows the reading levels of the various Level Monitoring Station points.

Date	1	2	3	4	5	6	7	8	9
16/04/2019	9.9279	9.9488	9.9766	9.9542	9.9120	9.7272	9.7238	9.6376	9.7109
14/06/2019	9.9289	9.9486	9.9774	9.9548	9.9120	9.7286	9.7254	9.6388	9.7129
21/08/2019	9.9279	9.9500	9.9763	9.9530	9.9093	9.7222	9.7193	9.6348	9.7064
05/11/2019	9.9254	9.9489	9.9755	9.9506	9.9066	9.7162	9.7130	9.6320	9.7025
31/12/2019	9.9268	9.9483	9.9757	9.9512	9.9068	9.7195	9.7168	9.6329	9.7050
21/02/2020	9.9265	9.9491	9.9761	9.9535	9.9093	9.7233	9.7201	9.6350	9.7075
16/04/2020	9.9279	9.9490	9.9765	9.9530	9.9094	9.7260	9.7233	9.6364	9.7101
10/06/2020	9.9283	9.9491	9.9759	9.9523	9.9086	9.7250	9.7218	9.6351	9.7089



Level Monitoring Difference Graphs

The following graphs display the progressive movement that each Level Monitoring Station recorded at each separate site visit date to give an overall look at how much the property is moving.

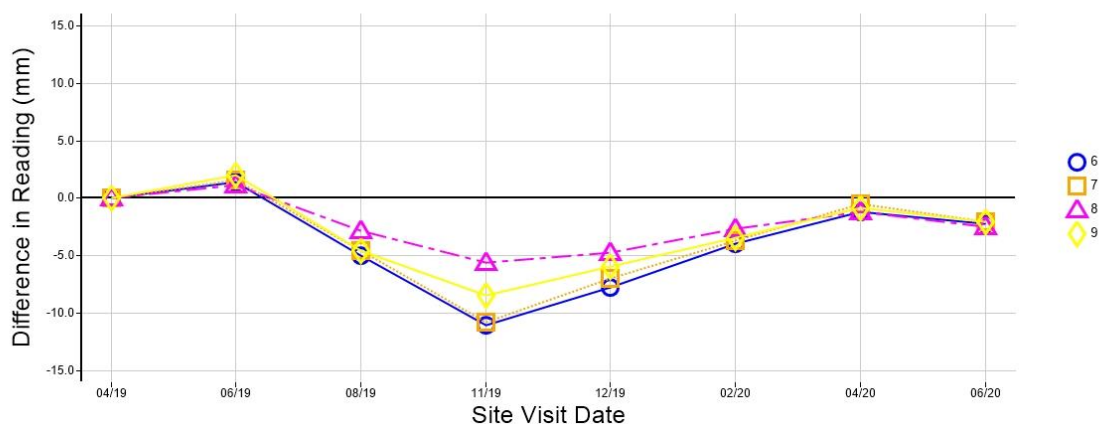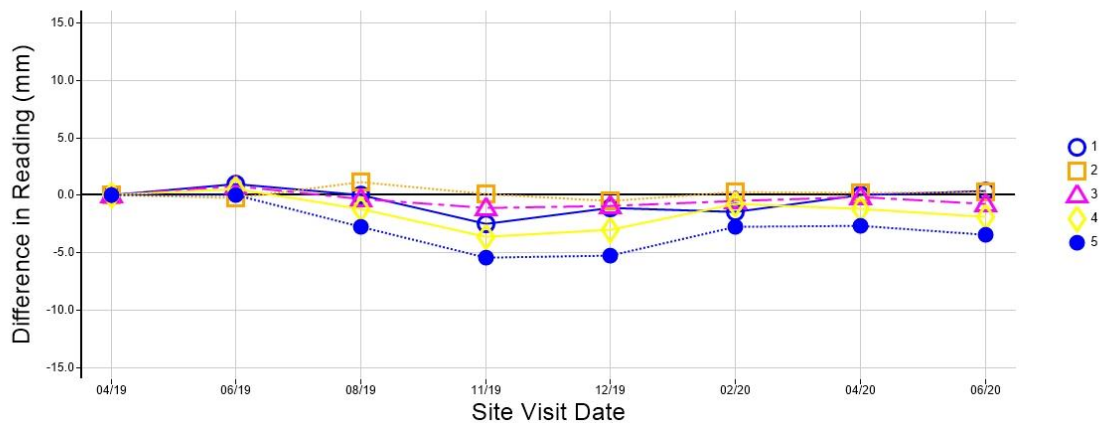

Level Monitoring Displacement Map

The following image shows an isometric representation of the movement of the property, based on the Level Monitoring Stations that were installed.

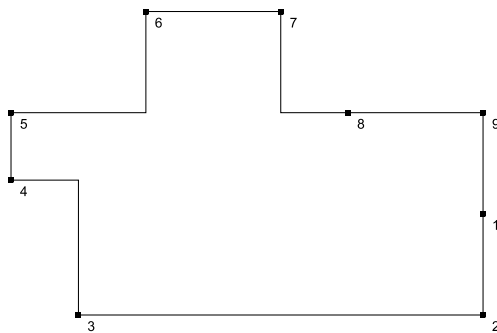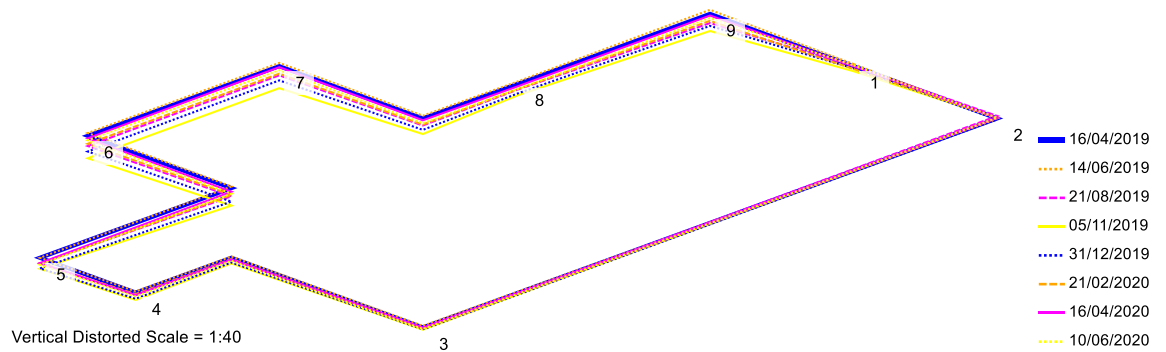

FRONT

Site Visit Notes

Datum is a point on the garage as requested, it has an assumed value of 10,000m. No suitable remote datum, so no secondary TBM available. If this is not suitable, please advise if a deep datum is required.

Site Visit: 16 April 2019

Relative survey.

Site Visit: 21 August 2019

Downwards and upwards movement noted and checked.