

Level and Crack Monitoring

Our Ref: 531994

Date of Issue: 28/09/2019

Provider Details

CET Property Services - 0116 2605309

Monitoring Details

Instruction Date:	17/08/2018		
Number of visits	6	Visit Frequency (Wks)	8

Visit Dates (future dates are estimated)

Setup	1	2	3	4	5	6
03/09/18	29/10/18	24/12/18	18/02/19	15/04/19	10/06/19	05/08/19

Client Details

Insurance Co.:	
Client Ref:	6846356
Client Name:	Sedgwick
Technical Mgr:	David Cliffe
Customer support	
Tel:	
Email:	

Risk Address


Occupier:	Removed for data protection purposes
Address:	71 Milman Road
Address:	
Town:	Reading
County:	
Post Code:	RG2 0AZ
Contact Name	Removed for data protection purposes

Level and Crack Monitoring - Site Sketch

Our Ref: 531994

Date of Issue: 28/09/2019

TBM HILTI
NAIL YELLOW
SPRAY IN

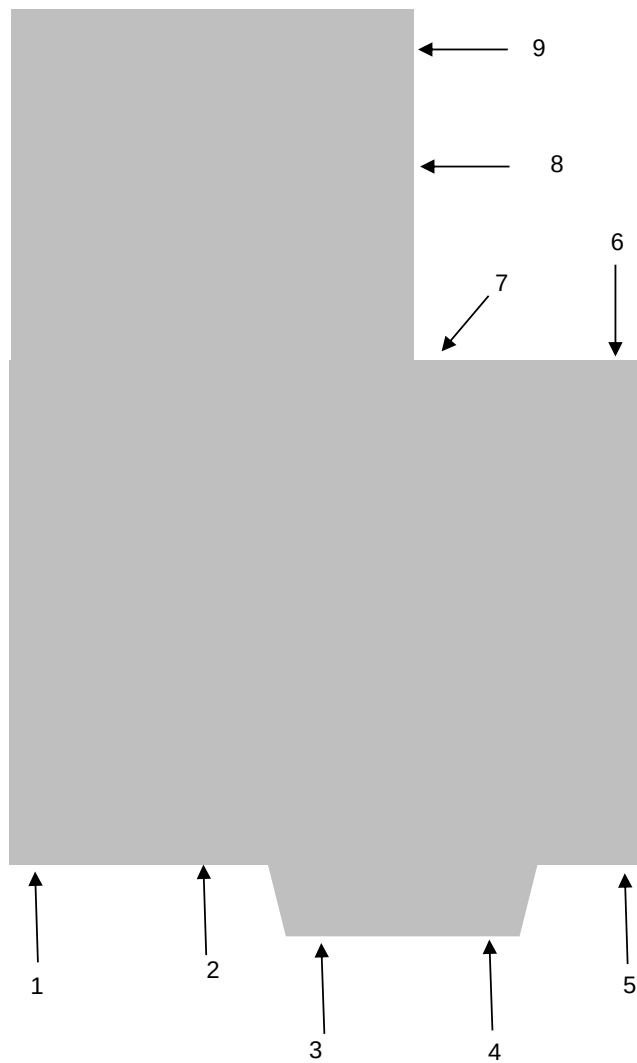

FRONT

Level Monitoring - Reduced Levels (in metres)

Our Ref:

531994

Date of Issue:

28/09/19

Reading Date	3/9/18	11/12/18	4/3/19	10/5/19	11/7/19	27/9/19						
Point / Reading	1	2	3	4	5	6	7	8	9	10	11	12
1	9.9866	9.9873	9.9880	9.9892	9.9891	9.9870						
2	9.9768	9.9780	9.9799	9.9811	9.9808	9.9769						
3	10.4748	10.4765	10.4787	10.4805	10.4797	10.4742						
4	10.4558	10.4577	10.4619	10.4637	10.4625	10.4550						
5	10.6161	10.6189	10.6234	10.6251	10.6236	10.6149						
6	9.4848	9.4889	9.4913	9.4946	9.4899	9.4826						
7	9.5822	9.5850	9.5863	9.5878	9.5857	9.5815						
8	9.4820	9.4836	9.4841	9.4859	9.4837	9.4818						
9	9.3798	9.3839	9.3841	9.3860	9.3838	9.3805						
not used												
not used												
not used												
not used												
not used												
not used												
not used												
Tech Initials	NM	NM	MT	MT	MT	RN						
Level S/N.	521947	521947	522222	521947	521948	701612						

Level Monitoring - Movement (in millimetres)

Our Ref:

531994

Date of Issue

28/09/19

[illegible]

Level Monitoring - Movement relative to datum against Date

