



SITE INVESTIGATION FACTUAL REPORT

Report No: SI-861364
Client: Crawford Claims Management
Site: 22 Russet Glade, Emmer Green
Reading
Client Ref: 1779439
Date of Visit: 14/06/2024



Home Emergency Response - Subsidence Investigation - Drainage Services – Crack & Level Monitoring – Property Video Surveys

East Building, Cable Drive, Walsall, WS2 7BN


☎ 0333 016 4477

✉ siinstructions@cet-uk.com

🌐 www.cet-uk.com

CET is the trading name of CET Structures Ltd

Registered in England No. 02527130

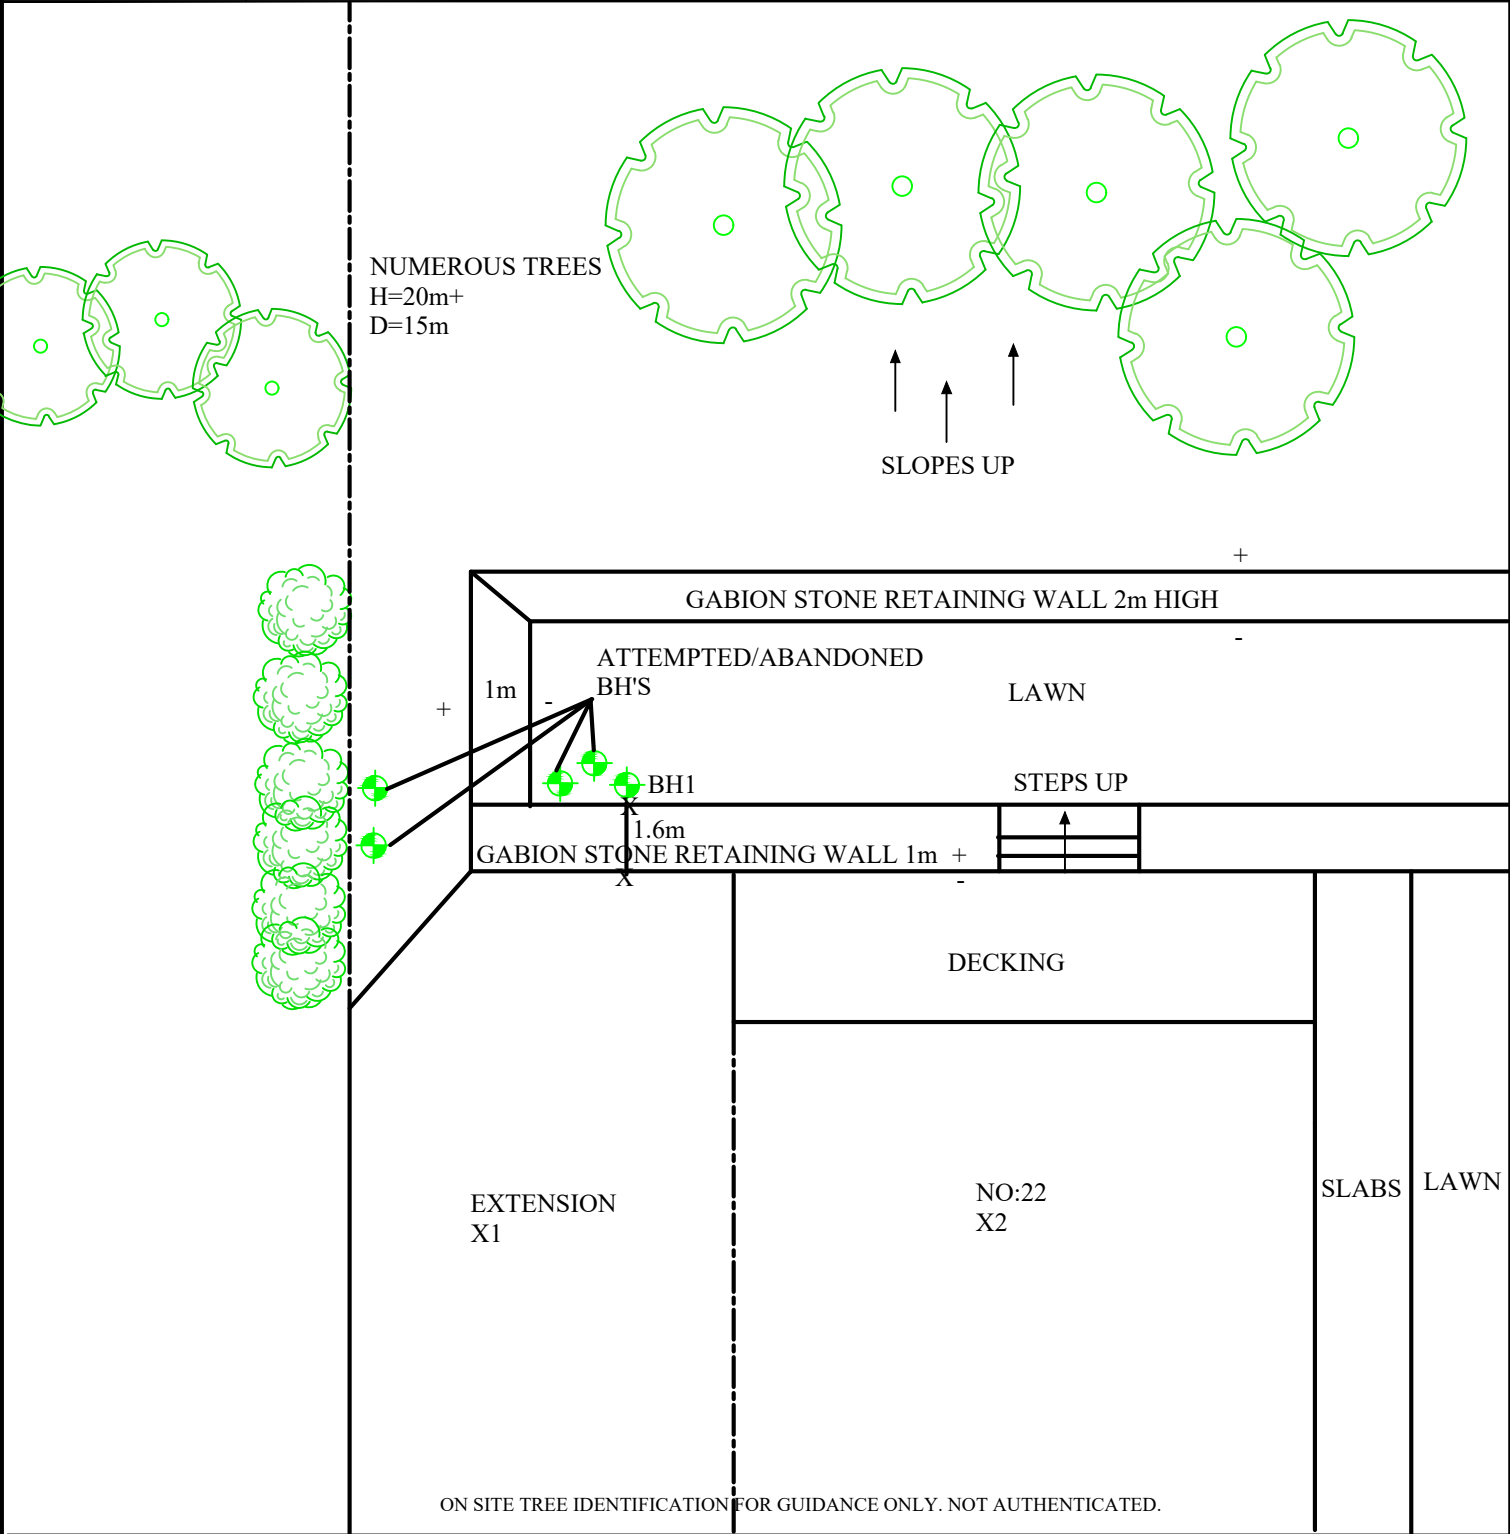

Borehole		1		Sheet:	1 of 1	Site:	22 RUSSET GLADE				
				Job No:	861364						
				Date:	14/06/2024						
Boring Method:		Hand Auger		Ground Level:		Client:	Crawford Claims Management				
Diameter (mm):		75	Weather:		Dry						
Depth	Soil Description					Thickness	Legend	Samples and Tests			
(m)								Depth	Type	Result	
0.00	MADEGROUND medium compact dark brown silty sandy clay with brick fragments and gravel					0.30					
0.30	Stiff light grey silty CLAY with partings of orange and red silt and fine sand					1.20	x — x				
							x — x				
							x — x				
							x — x				
							x — x				
							x — x				
							x — x				
							x — x				
							x — x	1.00	DV	124	
							x — x			130	
							x — x				
							x — x				
1.50	Very Stiff light grey silty CLAY with partings of orange and red silt and fine sand					1.50	x — x	1.50	DV	140+	
							x — x			140+	
							x — x				
							x — x				
							x — x				
							x — x				
							x — x				
							x — x	2.00	DV	140+	
							x — x			140+	
							x — x				
							x — x				
							x — x	2.50	DV	140+	
3.00	End of BH										
Remarks: BH ends at 3.0m. BH dry and open on completion, no roots observed below 1.8m. Borehole 1 was fifth attempt, previous attempts all encountered made ground obstructions to 1.2m below ground level, not logged.					Key:		To	Max			
							Depth	Dia			
							(m)	(mm)			
							1.80	1			
Logged:					KP	AM	Checked:	Approved:	Version	V1.0 28/01/16	N.T.S.